



AUSTIN SERVICE JOURNAL

Distributor & Dealer Organization

No. A / 278

* cancelling A/163

Fleet Users

No.

13 Sept. 1960

ACCELERATOR SHAFT BUSHES

AUSTIN-HEALEY 100-SIX
(BN.4 & BN.6)

AUSTIN-HEALEY 3000
(BN.7; BT.7)

Excessively worn felt bushes should be replaced by the Nylon and composition types which have been standardised for the Austin-Healey 3000.

Details are as below:

<u>Part No.</u> (Felt)	<u>Description</u>	<u>Qty.</u>	<u>Part No.</u>
1A1832	Bush - accelerator pedal shaft (engine side)	1	AHB8748 (Nylon)
1A1832	Bush - accelerator pedal shaft (pedal side)	1	AHB8950) (composition)
1A1832	Bush - accelerator cross-shaft	2	AHB8950)

In addition, the existing throttle relay shaft bearing (in the dash), Part No. 1G2175, should be replaced by a composition bush, Part No. AHB8944.

The above were fitted to the Healey 3000 from Car Nos:

7193	RHD)	BT.7
7190	LHD)	
7637	RHD)	BN.7.
7436	LHD)	

The positions of the original bushes and bearing are shown in Service Parts List AKD1151, plate 'AK', illustration Nos. 6, 18, 25 & 60 respectively.

* Relay shaft bearing included;
change points & Service Parts List reference added.